

Manhole Inspection Summary

Manhole # S35MM1001MH

Printed On: 12/17/2008

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **35MM1** Node: **001** Status: **Found**

Insp Date: **3/13/07 1:37 PM**

Incomplete Comments

Crew: **WM, BC**
Inspector: **Morris, W**
Firm: **RKK**

Location Address: **4501 UNDERWOOD RD**

Cross Street: **OLD COLDSPRING LA**

Manhole Type: **Junction**

Location: **Sidewalk**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

Cover

Shape: **Circular**

Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **0** (in.)

Condition: ☐ Sound

☐ Cracked

☒ **Leaks**

Chimney / Frame Adjustment

☒ Exists Material: **Brick**

☐ Parged Height: **4** (in.)

Condition: ☐ Sound

☒ **Cracked**

☐ Root Intrusion

☒ **Loose Brick**

☐ Deteriorated

Infiltration: ☐ None

☐ Joint

☒ **Cracks**

☐ Mortar

☐ Roots

☒ **Wall**

Corbel

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound

☐ Cracked

☐ Root Intrusion

☐ Loose Brick

☐ Deteriorated

Infiltration: ☐ None

☐ Joint

☐ Cracks

☐ Mortar

☐ Roots

☒ **Wall**

Barrel

Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **42** (in.) Length: (in.)

Condition: ☒ Sound

☐ Cracked

☐ Root Intrusion

☐ Loose Brick

☐ Deteriorated

Infiltration: ☐ None

☐ Joint

☐ Cracks

☐ Mortar

☐ Roots

☒ **Wall**

Bench

☒ Exists Material: **Brick**

☐ Parged

☒ **Debris** (not Condition related)

Condition: ☒ Sound

☐ Cracked

☐ Root Intrusion

☐ Deteriorated

☐ Leaks

☐ Debris

Channel

Material: **Brick**

☐ Parged

☒ **Debris** (not Condition related)

Channel Exposure: **Fully Open**

Junc Dist: **0**

nearest .5 ft. Azimuth:

Condition: ☒ Sound

☐ Cracked

☐ Root Intrusion

☐ Deteriorated

☐ Leaks

☐ Debris

Steps

Count: **5**

Missing: **0**

☒ **Corroded**

Surcharge

☐ Evidence Of Surcharge

Depth:

(ft.)

☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S35MM1001MH

Printed On: 12/17/2008

Page 2 of 4

Location View



Top View



Corroded steps. Bench and Channel debris.

Defect



Frame leaks. Frame offset. Adjustment deterioration, loose brick and infiltration.

Manhole Inspection Summary

Manhole # S35MM1001MH

Printed On: 12/17/2008

Page 3 of 4

8 in. Circular Gravity Sewer Pipe Out @ 12 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **10.98** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ **Mud** ☐ Sludge ☐ **Debris** ☐ Grease

Silt Depth: (in.) Deposits Extent:


Infiltration: **Evidence** Pipe Seal Cond: **Cracked**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer Pipe In @ 3 O'Clock

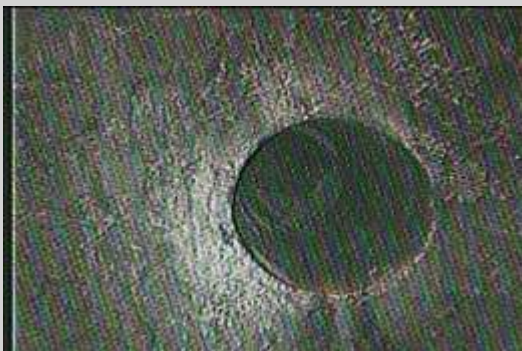

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **8.04** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ **Mud** ☐ Sludge ☐ **Debris** ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop In @ 3 O'Clock



Drop: **Outside** Rod and Bar

Angled: **Yes** Reading: **9.61** (ft.)

Inv Depth: **10.61** (ft.)

Drop Condition: **Open**

Connects To: **Dead End**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S35MM1001MH

Printed On: 12/17/2008

Page 4 of 4

8 in. Circular Gravity Sewer

Pipe In @ 6 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **10.90** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☒ **Mud** ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: **1** (in.) Deposits Extent: **Light**

Infiltration: **None** Pipe Seal Cond: **Cracked**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer

Pipe In @ 9 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **10.66** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ **None** ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Cracked**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection